

**PLEASE NOTE:**

This web page will be down for maintenance on Friday March 28, 2014 between 7:00 PM and 9:00 PM EDT. We apologize for this brief inconvenience.

## 2005 CHEVROLET COBALT

Recalls	Investigations	Complaints	Service Bulletins
4	0	1281	109

RECALLS: Displaying 1 - 4 out of 4

– **RECALL Subject : Ignition Switch may Turn Off**

**Report Receipt Date:** FEB 10, 2014  
**NHTSA Campaign Number:** 14V047000  
**Component(s):** AIR BAGS , ELECTRICAL SYSTEM

**All Products Associated with this Recall** ▼

**Details** ▲

**14 Associated Documents** ▼

**Manufacturer:** General Motors LLC

**SUMMARY:**

General Motors LLC (GM) announced on February 10, 2014 that they are recalling certain model year 2005-2007 Chevrolet Cobalt, and 2007 Pontiac G5 vehicles. Two weeks later, GM increased the recall to include an additional 748,024 model year 2006-2007 Chevrolet HHR and Pontiac Solstice vehicles and 2003-2007 Saturn Ion vehicles and 2007 Saturn Sky vehicles. In these models, the weight on the key ring and/or road conditions or some other jarring event may cause the ignition switch to move out of the run position, turning off the engine.

**CONSEQUENCE:**

If the key is not in the run position, the air bags may not deploy if the vehicle is involved in a crash, increasing the risk of injury.

**REMEDY:**

GM will notify owners, and dealers will replace the ignition switch, free of charge. An interim notification was issued to owners on March 10, 2014, informing them of the safety defect, and that they would receive another letter once parts are available. Owners may contact Chevrolet at 1-800-222-1020, Pontiac at 1-800-762-2737 or Saturn at 1-800-553-6000. GM's number for the initial recall is 13454 and 14063 for the expansion. Note: Until the recall repairs have been performed, it is very important that customers remove all items from their key rings, leaving only the vehicle key. The key fob (if applicable), should also be removed from the key ring.

**NOTES:**

Owners may also contact the National Highway Traffic Safety Administration Vehicle Safety Hotline at 1-888-327-4236 (TTY 1-800-424-9153), or go to [www.safercar.gov](http://www.safercar.gov).

– **RECALL Subject : ELECTRIC POWER STEERING , 1 INVESTIGATION(S)**

**Report Receipt Date:** MAR 03, 2010  
**NHTSA Campaign Number:** 10V073000  
**Component(s):** STEERING

**All Products Associated with this Recall** ▼

**Details** ▲

**27 Associated Documents** ▼

**Manufacturer:** GENERAL MOTORS CORP.

**SUMMARY:**

GENERAL MOTORS IS RECALLING CERTAIN MODEL YEAR 2005-2010 CHEVROLET COBALT AND MODEL YEAR 2007-2010 PONTIAC G5 VEHICLES EQUIPPED WITH ELECTRIC POWER STEERING. THE DRIVER MAY EXPERIENCE A SUDDEN LOSS OF POWER STEERING ASSIST THAT COULD OCCUR AT ANY TIME WHILE DRIVING.

**CONSEQUENCE:**

IF POWER STEERING ASSIST IS LOST, IT WOULD REQUIRE GREATER DRIVER EFFORT AT LOW VEHICLE SPEEDS, INCREASING THE RISK OF A

CRASH.

**REMEDY:**

DEALERS WILL REPLACE THE ELECTRIC POWER STEERING MOTOR FREE OF CHARGE. OWNERS ARE BEING NOTIFIED ON A ROLLING BASIS BETWEEN MARCH 29 THROUGH NOVEMBER 2010. A COPY OF THE MAILING SCHEDULE IS LOCATED IN THE RECALL FILE. OWNERS MAY CONTACT CHEVROLET AT 1-800-630-2438 AND PONTIAC AT 1-800-620-7668 OR AT THE OWNER CENTER AT WWW.GMOWNERCENTER.COM.

**NOTES:**

GM'S RECALL NO. N100023. OWNERS MAY ALSO CONTACT THE NATIONAL HIGHWAY TRAFFIC SAFETY ADMINISTRATION'S VEHICLE SAFETY HOTLINE AT 1-888-327-4236 (TTY 1-800-424-9153), OR GO TO [HTTP://WWW.SAFERCAR.GOV](http://www.safercar.gov).

1 Associated Investigation(s) ▼

– **RECALL Subject : FMVSS 201/HEADLINER TRIM**

Report Receipt Date: JAN 18, 2007

NHTSA Campaign Number: 07V014000

Component(s): STRUCTURE

All Products Associated with this Recall ▼

Details ▲

14 Associated Documents ▼

Manufacturer: GENERAL MOTORS CORP.

**SUMMARY:**

CERTAIN PASSENGER VEHICLES NOT EQUIPPED WITH OPTIONAL ROOF-MOUNTED SIDE IMPACT AIR BAGS FAIL TO COMPLY WITH THE REQUIREMENTS OF FEDERAL MOTOR VEHICLE SAFETY STANDARD NO. 201, 'OCCUPANT PROTECTION IN INTERIOR IMPACT.'

**CONSEQUENCE:**

IN A CRASH, HEAD IMPACT PROTECTION MAY BE INADEQUATE.

**REMEDY:**

DEALERS WILL INSTALL ENERGY ABSORBING PLASTIC TO THE HEADLINER TRIM TO REDUCE THE SEVERITY OF HEAD IMPACTS IN A CRASH. THE RECALL BEGAN ON MARCH 21, 2007. OWNERS MAY CONTACT CHEVROLET AT 1-800-630-2438.

**NOTES:**

GM RECALL NO. 06217. CUSTOMERS MAY ALSO CONTACT THE NATIONAL HIGHWAY TRAFFIC SAFETY ADMINISTRATION'S VEHICLE SAFETY HOTLINE AT 1-888-327-4236 (TTY 1-800-424-9153), OR GO TO [HTTP://WWW.SAFERCAR.GOV](http://www.safercar.gov).

– **RECALL Subject : GM/CHEVROLET/FMVSS 108/HEADLAMP BULB**

Report Receipt Date: NOV 22, 2004

NHTSA Campaign Number: 04V560000

Component(s): EXTERIOR LIGHTING

All Products Associated with this Recall ▼

Details ▲

10 Associated Documents ▼

Manufacturer: GENERAL MOTORS CORP.

**SUMMARY:**

CERTAIN PASSENGER VEHICLES FAIL TO COMPLY WITH THE REQUIREMENTS OF FEDERAL MOTOR VEHICLE SAFETY STANDARD NO. 108, "LAMPS, REFLECTIVE DEVICES, AND ASSOCIATED EQUIPMENT." THE BULB SHIELDS INSIDE OF THE HEADLAMPS CAN LOOSEN DUE TO VIBRATION.

**CONSEQUENCE:**

THE BULB SHIELD CAN LOOSEN OR BREAK BECAUSE OF VIBRATION. IF THIS OCCURRED ON A HEADLAMP INSTALLED IN A VEHICLE, ONCOMING DRIVERS MAY NOTICE ADDITIONAL GLARE, INCREASING THE RISK OF A CRASH.

**REMEDY:**

DEALERS WILL INSTALL TWO NEW HEADLAMP ASSEMBLIES. THE RECALL BEGAN ON NOVEMBER 17, 2004. OWNERS SHOULD CONTACT CHEVROLET AT 1-800-630-2438.

**NOTES:**

GM RECALL NO. 04100. CUSTOMERS CAN ALSO CONTACT THE NATIONAL HIGHWAY TRAFFIC SAFETY ADMINISTRATION'S AUTO SAFETY HOTLINE AT 1-888-DASH-2-DOT (1-888-327-4236).

**PLEASE NOTE:**

This web page will be down for maintenance on Friday March 28, 2014 between 7:00 PM and 9:00 PM EDT. We apologize for this brief inconvenience.

## 2006 CHEVROLET COBALT

Recalls	Investigations	Complaints	Service Bulletins
4	0	1643	92

RECALLS: Displaying 1 - 4 out of 4

– **RECALL Subject : Ignition Switch may Turn Off**

Report Receipt Date: FEB 10, 2014  
 NHTSA Campaign Number: 14V047000  
 Component(s): AIR BAGS , ELECTRICAL SYSTEM

All Products Associated with this Recall ▼

Details ▲

14 Associated Documents ▼

Manufacturer: General Motors LLC

**SUMMARY:**

General Motors LLC (GM) announced on February 10, 2014 that they are recalling certain model year 2005-2007 Chevrolet Cobalt, and 2007 Pontiac G5 vehicles. Two weeks later, GM increased the recall to include an additional 748,024 model year 2006-2007 Chevrolet HHR and Pontiac Solstice vehicles and 2003-2007 Saturn Ion vehicles and 2007 Saturn Sky vehicles. In these models, the weight on the key ring and/or road conditions or some other jarring event may cause the ignition switch to move out of the run position, turning off the engine.

**CONSEQUENCE:**

If the key is not in the run position, the air bags may not deploy if the vehicle is involved in a crash, increasing the risk of injury.

**REMEDY:**

GM will notify owners, and dealers will replace the ignition switch, free of charge. An interim notification was issued to owners on March 10, 2014, informing them of the safety defect, and that they would receive another letter once parts are available. Owners may contact Chevrolet at 1-800-222-1020, Pontiac at 1-800-762-2737 or Saturn at 1-800-553-6000. GM's number for the initial recall is 13454 and 14063 for the expansion. Note: Until the recall repairs have been performed, it is very important that customers remove all items from their key rings, leaving only the vehicle key. The key fob (if applicable), should also be removed from the key ring.

**NOTES:**

Owners may also contact the National Highway Traffic Safety Administration Vehicle Safety Hotline at 1-888-327-4236 (TTY 1-800-424-9153), or go to [www.safercar.gov](http://www.safercar.gov).

– **RECALL Subject : ELECTRIC POWER STEERING , 1 INVESTIGATION(S)**

Report Receipt Date: MAR 03, 2010  
 NHTSA Campaign Number: 10V073000  
 Component(s): STEERING

All Products Associated with this Recall ▼

Details ▲

27 Associated Documents ▼

Manufacturer: GENERAL MOTORS CORP.

**SUMMARY:**

GENERAL MOTORS IS RECALLING CERTAIN MODEL YEAR 2005-2010 CHEVROLET COBALT AND MODEL YEAR 2007-2010 PONTIAC G5 VEHICLES EQUIPPED WITH ELECTRIC POWER STEERING. THE DRIVER MAY EXPERIENCE A SUDDEN LOSS OF POWER STEERING ASSIST THAT COULD OCCUR AT ANY TIME WHILE DRIVING.

**CONSEQUENCE:**

IF POWER STEERING ASSIST IS LOST, IT WOULD REQUIRE GREATER DRIVER EFFORT AT LOW VEHICLE SPEEDS, INCREASING THE RISK OF A

CRASH.

**REMEDY:**

DEALERS WILL REPLACE THE ELECTRIC POWER STEERING MOTOR FREE OF CHARGE. OWNERS ARE BEING NOTIFIED ON A ROLLING BASIS BETWEEN MARCH 29 THROUGH NOVEMBER 2010. A COPY OF THE MAILING SCHEDULE IS LOCATED IN THE RECALL FILE. OWNERS MAY CONTACT CHEVROLET AT 1-800-630-2438 AND PONTIAC AT 1-800-620-7668 OR AT THE OWNER CENTER AT WWW.GMOWNERCENTER.COM.

**NOTES:**

GM'S RECALL NO. N100023. OWNERS MAY ALSO CONTACT THE NATIONAL HIGHWAY TRAFFIC SAFETY ADMINISTRATION'S VEHICLE SAFETY HOTLINE AT 1-888-327-4236 (TTY 1-800-424-9153), OR GO TO [HTTP://WWW.SAFERCAR.GOV](http://www.safercar.gov) .

1 Associated Investigation(s) ▼

– RECALL Subject : FUEL PUMP MODULE

Report Receipt Date: OCT 29, 2009

NHTSA Campaign Number: 09V419000

Component(s): FUEL SYSTEM, GASOLINE

All Products Associated with this Recall ▼

Details ▲

15 Associated Documents ▼

Manufacturer: GENERAL MOTORS CORP.

**SUMMARY:**

GENERAL MOTORS IS RECALLING CERTAIN MODEL YEAR 2006 CHEVROLET COBALT AND SATURN ION VEHICLES ORIGINALLY SOLD IN OR CURRENTLY REGISTERED IN THE STATES OF ARIZONA AND NEVADA; AND MODEL YEAR 2007 CHEVROLET COBALT, PONTIAC G5 AND SATURN ION VEHICLES ORIGINALLY SOLD IN OR CURRENTLY REGISTERED IN THE STATES OF ARIZONA, CALIFORNIA, FLORIDA, NEVADA AND TEXAS. THE PLASTIC SUPPLY OR RETURN PORT ON THE MODULAR RESERVOIR ASSEMBLY MAY CRACK. IF EITHER OF THESE PORTS DEVELOPS A CRACK, FUEL WILL LEAK FROM THE AREA. IF THE CRACK BECOMES LARGE ENOUGH, FUEL MAY BE OBSERVED DRIPPING ONTO THE GROUND AND VEHICLE PERFORMANCE MAY BE AFFECTED.

**CONSEQUENCE:**

FUEL LEAKAGE, IN THE PRESENCE OF AN IGNITION SOURCE, COULD RESULT IN A FIRE.

**REMEDY:**

DEALERS WILL REPLACE THE FUEL PUMP MODULE FREE OF CHARGE. A SPECIAL COVERAGE WILL BE IMPLEMENTED IN THE SAME TIME FRAME FOR MODEL YEAR 2006 VEHICLES REGISTERED IN ALABAMA, ARKANSAS, CALIFORNIA, FLORIDA, GEORGIA, HAWAII, LOUISIANA, MISSISSIPPI, NORTH CAROLINA, NEW MEXICO, OKLAHOMA, SOUTH CAROLINA, TENNESSEE AND TEXAS AND MODEL YEAR 2007 VEHICLES REGISTERED IN: ALABAMA, ARKANSAS, GEORGIA, HAWAII, LOUISIANA, MISSISSIPPI, NORTH CAROLINA, NEW MEXICO, OKLAHOMA, SOUTH CAROLINA AND TENNESSEE. THE SAFETY RECALL IS EXPECTED TO BEGIN ON OR BEFORE FEBRUARY 4, 2010. OWNERS MAY CONTACT CHEVROLET AT 1-800-630-2438, SATURN AT 1-800-972-8876 AND PONTIAC AT 1-800-620-7668 OR AT THE OWNER CENTER AT WWW.GMOWNERCENTER.COM.

**NOTES:**

GM RECALL NO. 090226. OWNERS MAY ALSO CONTACT THE NATIONAL HIGHWAY TRAFFIC SAFETY ADMINISTRATION'S VEHICLE SAFETY HOTLINE AT 1-888-327-4236 (TTY 1-800-424-9153), OR GO TO [HTTP://WWW.SAFERCAR.GOV](http://www.safercar.gov) .

– RECALL Subject : FMVSS 201/HEADLINER TRIM

Report Receipt Date: JAN 18, 2007

NHTSA Campaign Number: 07V014000

Component(s): STRUCTURE

All Products Associated with this Recall ▼

Details ▲

14 Associated Documents ▼

Manufacturer: GENERAL MOTORS CORP.

**SUMMARY:**

CERTAIN PASSENGER VEHICLES NOT EQUIPPED WITH OPTIONAL ROOF-MOUNTED SIDE IMPACT AIR BAGS FAIL TO COMPLY WITH THE REQUIREMENTS OF FEDERAL MOTOR VEHICLE SAFETY STANDARD NO. 201, 'OCCUPANT PROTECTION IN INTERIOR IMPACT.'

**CONSEQUENCE:**

IN A CRASH, HEAD IMPACT PROTECTION MAY BE INADEQUATE.

**REMEDY:**

DEALERS WILL INSTALL ENERGY ABSORBING PLASTIC TO THE HEADLINER TRIM TO REDUCE THE SEVERITY OF HEAD IMPACTS IN A CRASH. THE RECALL BEGAN ON MARCH 21, 2007. OWNERS MAY CONTACT CHEVROLET AT 1-800-630-2438.

**NOTES:**

GM RECALL NO. 06217. CUSTOMERS MAY ALSO CONTACT THE NATIONAL HIGHWAY TRAFFIC SAFETY ADMINISTRATION'S VEHICLE SAFETY

**PLEASE NOTE:**

This web page will be down for maintenance on Friday March 28, 2014 between 7:00 PM and 9:00 PM EDT. We apologize for this brief inconvenience.

## 2007 CHEVROLET COBALT

Recalls	Investigations	Complaints	Service Bulletins
4	0	930	58

RECALLS: Displaying 1 - 4 out of 4

### – RECALL Subject : Ignition Switch may Turn Off

Report Receipt Date: FEB 10, 2014  
 NHTSA Campaign Number: 14V047000  
 Component(s): AIR BAGS , ELECTRICAL SYSTEM

#### All Products Associated with this Recall ▼

#### Details ▲

[14 Associated Documents ▼](#)

Manufacturer: General Motors LLC

#### SUMMARY:

General Motors LLC (GM) announced on February 10, 2014 that they are recalling certain model year 2005-2007 Chevrolet Cobalt, and 2007 Pontiac G5 vehicles. Two weeks later, GM increased the recall to include an additional 748,024 model year 2006-2007 Chevrolet HHR and Pontiac Solstice vehicles and 2003-2007 Saturn Ion vehicles and 2007 Saturn Sky vehicles. In these models, the weight on the key ring and/or road conditions or some other jarring event may cause the ignition switch to move out of the run position, turning off the engine.

#### CONSEQUENCE:

If the key is not in the run position, the air bags may not deploy if the vehicle is involved in a crash, increasing the risk of injury.

#### REMEDY:

GM will notify owners, and dealers will replace the ignition switch, free of charge. An interim notification was issued to owners on March 10, 2014, informing them of the safety defect, and that they would receive another letter once parts are available. Owners may contact Chevrolet at 1-800-222-1020, Pontiac at 1-800-762-2737 or Saturn at 1-800-553-6000. GM's number for the initial recall is 13454 and 14063 for the expansion. Note: Until the recall repairs have been performed, it is very important that customers remove all items from their key rings, leaving only the vehicle key. The key fob (if applicable), should also be removed from the key ring.

#### NOTES:

Owners may also contact the National Highway Traffic Safety Administration Vehicle Safety Hotline at 1-888-327-4236 (TTY 1-800-424-9153), or go to [www.safercar.gov](http://www.safercar.gov).

### – RECALL Subject : Fuel Pump Module May Crack

Report Receipt Date: SEP 19, 2012  
 NHTSA Campaign Number: 12V459000  
 Component(s): FUEL SYSTEM, GASOLINE

#### All Products Associated with this Recall ▼

#### Details ▲

[22 Associated Documents ▼](#)

Manufacturer: General Motors LLC

#### SUMMARY:

General Motors (GM) is recalling certain model year 2007 Chevrolet Equinox and Pontiac Torrent vehicles originally sold or currently registered in Arizona, California, Nevada, and Texas; model year 2007 Chevrolet Cobalt, Pontiac G5, and Saturn ION vehicles originally sold, or currently registered in, Arizona, California, Florida, Nevada, or Texas; model year 2008 Chevrolet Cobalt and Pontiac G5 vehicles originally sold, or currently registered in, Arizona; and model year 2009 Chevrolet Cobalt and Pontiac G5 vehicles originally sold, or currently registered in, Arkansas, Arizona, California, Nevada, Oklahoma, or Texas. Some of these vehicles have a condition in which the plastic supply or return port on the fuel pump module may crack, which could cause a fuel leak.

**CONSEQUENCE:**

Fuel leakage in the presence of an ignition source may result in a fire.

**REMEDY:**

GM will notify owners, and dealers will replace the fuel pump module, free of charge. Notification to owners began on on November 21, 2012. Owners were instructed to not bring their vehicles in for repair until January 2013. Owners may contact General Motors at 1-800-521-7300.

**NOTES:**

GM's campaign number is 12190. This recall is an expansion of recall 09V-419. Owners may also contact the National Highway Traffic Safety Administration's Vehicle Safety Hotline at 1-888-327-4236 (TTY: 1-800-424-9153), or go to [www.safercar.gov](http://www.safercar.gov).

---

**– RECALL Subject : ELECTRIC POWER STEERING , 1 INVESTIGATION(S)**


---

Report Receipt Date: MAR 03, 2010

NHTSA Campaign Number: 10V073000

Component(s): STEERING

All Products Associated with this Recall ▼

Details ▲

27 Associated Documents ▼

Manufacturer: GENERAL MOTORS CORP.

**SUMMARY:**

GENERAL MOTORS IS RECALLING CERTAIN MODEL YEAR 2005-2010 CHEVROLET COBALT AND MODEL YEAR 2007-2010 PONTIAC G5 VEHICLES EQUIPPED WITH ELECTRIC POWER STEERING. THE DRIVER MAY EXPERIENCE A SUDDEN LOSS OF POWER STEERING ASSIST THAT COULD OCCUR AT ANY TIME WHILE DRIVING.

**CONSEQUENCE:**

IF POWER STEERING ASSIST IS LOST, IT WOULD REQUIRE GREATER DRIVER EFFORT AT LOW VEHICLE SPEEDS, INCREASING THE RISK OF A CRASH.

**REMEDY:**

DEALERS WILL REPLACE THE ELECTRIC POWER STEERING MOTOR FREE OF CHARGE. OWNERS ARE BEING NOTIFIED ON A ROLLING BASIS BETWEEN MARCH 29 THROUGH NOVEMBER 2010. A COPY OF THE MAILING SCHEDULE IS LOCATED IN THE RECALL FILE. OWNERS MAY CONTACT CHEVROLET AT 1-800-630-2438 AND PONTIAC AT 1-800-620-7668 OR AT THE OWNER CENTER AT [WWW.GMOWNERCENTER.COM](http://www.gmownercenter.com).

**NOTES:**

GM'S RECALL NO. N100023. OWNERS MAY ALSO CONTACT THE NATIONAL HIGHWAY TRAFFIC SAFETY ADMINISTRATION'S VEHICLE SAFETY HOTLINE AT 1-888-327-4236 (TTY 1-800-424-9153), OR GO TO [HTTP://WWW.SAFERCAR.GOV](http://www.safercar.gov) .

1 Associated Investigation(s) ▼

---

**– RECALL Subject : FUEL PUMP MODULE**


---

Report Receipt Date: OCT 29, 2009

NHTSA Campaign Number: 09V419000

Component(s): FUEL SYSTEM, GASOLINE

All Products Associated with this Recall ▼

Details ▲

15 Associated Documents ▼

Manufacturer: GENERAL MOTORS CORP.

**SUMMARY:**

GENERAL MOTORS IS RECALLING CERTAIN MODEL YEAR 2006 CHEVROLET COBALT AND SATURN ION VEHICLES ORIGINALLY SOLD IN OR CURRENTLY REGISTERED IN THE STATES OF ARIZONA AND NEVADA; AND MODEL YEAR 2007 CHEVROLET COBALT, PONTIAC G5 AND SATURN ION VEHICLES ORIGINALLY SOLD IN OR CURRENTLY REGISTERED IN THE STATES OF ARIZONA, CALIFORNIA, FLORIDA, NEVADA AND TEXAS. THE PLASTIC SUPPLY OR RETURN PORT ON THE MODULAR RESERVOIR ASSEMBLY MAY CRACK. IF EITHER OF THESE PORTS DEVELOPS A CRACK, FUEL WILL LEAK FROM THE AREA. IF THE CRACK BECOMES LARGE ENOUGH, FUEL MAY BE OBSERVED DRIPPING ONTO THE GROUND AND VEHICLE PERFORMANCE MAY BE AFFECTED.

**CONSEQUENCE:**

FUEL LEAKAGE, IN THE PRESENCE OF AN IGNITION SOURCE, COULD RESULT IN A FIRE.

**REMEDY:**

DEALERS WILL REPLACE THE FUEL PUMP MODULE FREE OF CHARGE. A SPECIAL COVERAGE WILL BE IMPLEMENTED IN THE SAME TIME FRAME FOR MODEL YEAR 2006 VEHICLES REGISTERED IN ALABAMA, ARKANSAS, CALIFORNIA, FLORIDA, GEORGIA, HAWAII, LOUISIANA, MISSISSIPPI, NORTH CAROLINA, NEW MEXICO, OKLAHOMA, SOUTH CAROLINA, TENNESSEE AND TEXAS AND MODEL YEAR 2007 VEHICLES REGISTERED IN: ALABAMA, ARKANSAS, GEORGIA, HAWAII, LOUISIANA, MISSISSIPPI, NORTH CAROLINA, NEW MEXICO, OKLAHOMA, SOUTH CAROLINA AND TENNESSEE. THE SAFETY RECALL IS EXPECTED TO BEGIN ON OR BEFORE FEBRUARY 4, 2010. OWNERS MAY CONTACT CHEVROLET AT 1-800-630-2438, SATURN AT 1-800-972-8876 AND PONTIAC AT 1-800-620-7668 OR AT THE OWNER CENTER AT [WWW.GMOWNERCENTER.COM](http://www.gmownercenter.com).

**PLEASE NOTE:**

This web page will be down for maintenance on Friday March 28, 2014 between 7:00 PM and 9:00 PM EDT. We apologize for this brief inconvenience.

## 2008 CHEVROLET COBALT

Recalls	Investigations	Complaints	Service Bulletins
2	0	319	48

RECALLS: Displaying 1 - 2 out of 2

### – RECALL Subject : Fuel Pump Module May Crack

Report Receipt Date: SEP 19, 2012  
 NHTSA Campaign Number: 12V459000  
 Component(s): FUEL SYSTEM, GASOLINE

All Products Associated with this Recall ▼

Details ▲

22 Associated Documents ▼

Manufacturer: General Motors LLC

#### SUMMARY:

General Motors (GM) is recalling certain model year 2007 Chevrolet Equinox and Pontiac Torrent vehicles originally sold or currently registered in Arizona, California, Nevada, and Texas; model year 2007 Chevrolet Cobalt, Pontiac G5, and Saturn ION vehicles originally sold, or currently registered in, Arizona, California, Florida, Nevada, or Texas; model year 2008 Chevrolet Cobalt and Pontiac G5 vehicles originally sold, or currently registered in, Arizona; and model year 2009 Chevrolet Cobalt and Pontiac G5 vehicles originally sold, or currently registered in, Arkansas, Arizona, California, Nevada, Oklahoma, or Texas. Some of these vehicles have a condition in which the plastic supply or return port on the fuel pump module may crack, which could cause a fuel leak.

#### CONSEQUENCE:

Fuel leakage in the presence of an ignition source may result in a fire.

#### REMEDY:

GM will notify owners, and dealers will replace the fuel pump module, free of charge. Notification to owners began on on November 21, 2012. Owners were instructed to not bring their vehicles in for repair until January 2013. Owners may contact General Motors at 1-800-521-7300.

#### NOTES:

GM's campaign number is 12190. This recall is an expansion of recall 09V-419. Owners may also contact the National Highway Traffic Safety Administration's Vehicle Safety Hotline at 1-888-327-4236 (TTY: 1-800-424-9153), or go to [www.safercar.gov](http://www.safercar.gov).

### – RECALL Subject : ELECTRIC POWER STEERING , 1 INVESTIGATION(S)

Report Receipt Date: MAR 03, 2010  
 NHTSA Campaign Number: 10V073000  
 Component(s): STEERING

All Products Associated with this Recall ▼

Details ▲

27 Associated Documents ▼

Manufacturer: GENERAL MOTORS CORP.

#### SUMMARY:

GENERAL MOTORS IS RECALLING CERTAIN MODEL YEAR 2005-2010 CHEVROLET COBALT AND MODEL YEAR 2007-2010 PONTIAC G5 VEHICLES EQUIPPED WITH ELECTRIC POWER STEERING. THE DRIVER MAY EXPERIENCE A SUDDEN LOSS OF POWER STEERING ASSIST THAT COULD OCCUR AT ANY TIME WHILE DRIVING.

#### CONSEQUENCE:

IF POWER STEERING ASSIST IS LOST, IT WOULD REQUIRE GREATER DRIVER EFFORT AT LOW VEHICLE SPEEDS, INCREASING THE RISK OF A CRASH.

**REMEDY:**

DEALERS WILL REPLACE THE ELECTRIC POWER STEERING MOTOR FREE OF CHARGE. OWNERS ARE BEING NOTIFIED ON A ROLLING BASIS BETWEEN MARCH 29 THROUGH NOVEMBER 2010. A COPY OF THE MAILING SCHEDULE IS LOCATED IN THE RECALL FILE. OWNERS MAY CONTACT CHEVROLET AT 1-800-630-2438 AND PONTIAC AT 1-800-620-7668 OR AT THE OWNER CENTER AT [WWW.GMOWNERCENTER.COM](http://www.gmownercenter.com).

**NOTES:**

GM'S RECALL NO. N100023. OWNERS MAY ALSO CONTACT THE NATIONAL HIGHWAY TRAFFIC SAFETY ADMINISTRATION'S VEHICLE SAFETY HOTLINE AT 1-888-327-4236 (TTY 1-800-424-9153), OR GO TO [HTTP://WWW.SAFERCAR.GOV](http://www.safercar.gov).

1 Associated Investigation(s) ▼

1200 New Jersey Avenue, SE, West Building Washington DC 20590 USA 1.888.327.4236 TTY 1.800.424.9153





**PLEASE NOTE:**  
 This web page will be down for maintenance on Friday March 28, 2014 between 7:00 PM and 9:00 PM EDT. We apologize for this brief inconvenience.

## 2009 CHEVROLET COBALT

Recalls	Investigations	Complaints	Service Bulletins
<b>3</b>	<b>0</b>	<b>198</b>	<b>42</b>

Below is a list of Service Bulletins issued for this product. Service Bulletins are instructions from the Manufacturer regarding the repair of a product.

SERVICE BULLETINS: Displaying 1 - 5 out of 42

**Service Bulletin No.:** PI-0018-B **NHTSA ID Number:** 10054243  
**Component(s):** STRUCTURE , VISIBILITY

**All Products Associated with this Service Bulletin** ▼

**Details** ▲ **0 Associated Documents**

**Manufacturer:** General Motors LLC

**SUMMARY:**  
 GENERAL MOTORS: THE WINDOWS, FRONT AND REAR, WOULD BIND, POOR FIT, MISALIGNMENT, MAKES RATTLE OR SQUEAKING NOISES, MOVES SLOWLY AND IS INOPERATIVE. MODEL 2008-2014 VEHICLES AND TRUCKS. \*PE

**Service Bulletin No.:** SB=12191 **NHTSA ID Number:** 10051936  
**Component(s):** FUEL SYSTEM, GASOLINE , FUEL SYSTEM, OTHER

**All Products Associated with this Service Bulletin** ▼

**Details** ▲ **2 Associated Documents** ▼

**Manufacturer:** General Motors LLC

**SUMMARY:**  
 CHEVROLET/PONTIAC/SATURN: SEE DOCUMENT SEARCH BUTTON FOR OWNER LETTER. ON FUEL PUMP MODULE, PLASTIC SUPPLY OR RETURN PORT MAY BE CRACK AND WILL DEVELOP A FUEL LEAKAGE WHEREBY FUEL ODOR IS NOTICED, WHEN DRIVEN OR PARKED. PARTS AVAILABILITY WILL DONE IN PHASES. 2006-2009 COBALT, 2007-2009 G5, 2006-2007 ION, 2006 PURSUIT AND THEN 2008-2009 EQUINOX, UPLANDER, MONTANA SV6, TORRENT. \*PE UPDATED 10/17/13. \*PE

**Service Bulletin No.:** PIC-5671-C **NHTSA ID Number:** 10047360  
**Component(s):** FUEL SYSTEM, OTHER

**All Products Associated with this Service Bulletin** ▼

**Details** ▲ **0 Associated Documents**

**Manufacturer:** General Motors LLC

**SUMMARY:**  
 CHEVROLET/PONTIAC: FUEL TANK COVER ASSEMBLY (NU6 EMISSION PACKAGE) CAN NOT BE ORDERED THRU DEALERSHIP DUE TO PARTS (25815572 AND 25948766) BEING PLACED ON RETRICTION THRU PRODUCT QUALITY CENTER (PQC). MODELS 2007-2010 COBALT, G5 AND 2007 ION. \*PE

**Service Bulletin No.:** PI-0817 **NHTSA ID Number:** 10047261  
**Component(s):** ELECTRICAL SYSTEM , FUEL SYSTEM, GASOLINE

**All Products Associated with this Service Bulletin** ▼

**Details** ▲ **0 Associated Documents**

**Manufacturer:** General Motors LLC

**SUMMARY:**

CHEVROLET/PONTIAC/SATURN: ENGINE FAILS TO START AFTER ENGINE CRANKS DUE TO FUEL PUMP WIRE HARNESS CONNECTOR NEEDS REPLACING, WITHOUT REPLACING FUEL PUMP COVER ASSEMBLY (FUEL PUMP FLANGE). MODEL 2007-2010 COBALT, G5, ION. \*PE

**Service Bulletin No.:** PIT5074F

**NHTSA ID Number:** 10044242

**Component(s):** ELECTRICAL SYSTEM

**All Products Associated with this Service Bulletin** ▼

**Details** ▲

**0 Associated Documents**

**Manufacturer:** General Motors LLC

**SUMMARY:**

GM: J-35616-64B TERMINAL TEST PROBE AND REPLACEMENT TERMINAL. ALSO INCLUDED MODELS VERANO, REGAL, LACROSSE, CTS, SRX, VOLT, SONIC, MALIBU, IMPALA, EQUINOX, CRUZE, AVALANCHE, TAHOE SUBURBAN, SILVERADO, SIERRA, YUKON, AND TERRAIN FOR MODEL YEAR 2013. MODEL ESCALADE MODEL YEAR 2012-2013. MODEL PONTIAC G3 MODEL YEAR 2007. MODEL WAVE MODEL YEARS 2005-2010. DENALI MODELS MODEL YEARS 2007-2013. \*JS

**PLEASE NOTE:**

This web page will be down for maintenance on Friday March 28, 2014 between 7:00 PM and 9:00 PM EDT. We apologize for this brief inconvenience.

## 2010 CHEVROLET COBALT

Recalls	Investigations	Complaints	Service Bulletins
1	0	188	27

RECALLS: Displaying 1 - 1 out of 1

— RECALL Subject : ELECTRIC POWER STEERING , 1 INVESTIGATION(S)

Report Receipt Date: MAR 03, 2010  
 NHTSA Campaign Number: 10V073000  
 Component(s): STEERING

All Products Associated with this Recall ▼

Details ▲

27 Associated Documents ▼

Manufacturer: GENERAL MOTORS CORP.

**SUMMARY:**

GENERAL MOTORS IS RECALLING CERTAIN MODEL YEAR 2005-2010 CHEVROLET COBALT AND MODEL YEAR 2007-2010 PONTIAC G5 VEHICLES EQUIPPED WITH ELECTRIC POWER STEERING. THE DRIVER MAY EXPERIENCE A SUDDEN LOSS OF POWER STEERING ASSIST THAT COULD OCCUR AT ANY TIME WHILE DRIVING.

**CONSEQUENCE:**

IF POWER STEERING ASSIST IS LOST, IT WOULD REQUIRE GREATER DRIVER EFFORT AT LOW VEHICLE SPEEDS, INCREASING THE RISK OF A CRASH.

**REMEDY:**

DEALERS WILL REPLACE THE ELECTRIC POWER STEERING MOTOR FREE OF CHARGE. OWNERS ARE BEING NOTIFIED ON A ROLLING BASIS BETWEEN MARCH 29 THROUGH NOVEMBER 2010. A COPY OF THE MAILING SCHEDULE IS LOCATED IN THE RECALL FILE. OWNERS MAY CONTACT CHEVROLET AT 1-800-630-2438 AND PONTIAC AT 1-800-620-7668 OR AT THE OWNER CENTER AT WWW.GMOWNERCENTER.COM.

**NOTES:**

GM'S RECALL NO. N100023. OWNERS MAY ALSO CONTACT THE NATIONAL HIGHWAY TRAFFIC SAFETY ADMINISTRATION'S VEHICLE SAFETY HOTLINE AT 1-888-327-4236 (TTY 1-800-424-9153), OR GO TO [HTTP://WWW.SAFERCAR.GOV](http://www.safercar.gov) .

1 Associated Investigation(s) ▼



**PLEASE NOTE:**

This web page will be down for maintenance on Friday March 28, 2014 between 7:00 PM and 9:00 PM EDT. We apologize for this brief inconvenience.

## 2011 CHEVROLET CRUZE

Recalls	Investigations	Complaints	Service Bulletins
6	0	209	68

RECALLS: Displaying 1 - 5 out of 6

– **RECALL Subject : Possible Loss of Braking Assist**

**Report Receipt Date:** AUG 15, 2013  
**NHTSA Campaign Number:** 13V360000  
**Component(s):** SERVICE BRAKES, HYDRAULIC

**All Products Associated with this Recall** ▼

**Details** ▲

**6 Associated Documents** ▼

**Manufacturer:** General Motors LLC

**SUMMARY:**

General Motors (GM) is recalling certain model year 2011-2012 Chevrolet Cruze vehicles equipped with 1.4L DOHC gasoline turbo engines and 6T40 front wheel drive automatic transmissions and equipped with an electric vacuum pump to provide supplemental vacuum for brake assist, when needed. In the affected vehicles, the pump may not activate, resulting in an intermittent reduction or loss of brake assist.

**CONSEQUENCE:**

A loss of braking assistance will require extra pedal force and/or distance to bring the vehicle to a stop, increasing the risk of a crash.

**REMEDY:**

General Motors will notify owners, and dealers will replace a microswitch in the power brake vacuum pipe assembly, free of charge. The recall began on October 7, 2013. Owners may contact Chevrolet at 1-800-222-1020. GM's recall number is 12213.

**NOTES:**

Owners may also contact the National Highway Traffic Safety Administration Vehicle Safety Hotline at 1-888-327-4236 (TTY 1-800-424-9153), or go to [www.safercar.gov](http://www.safercar.gov).

– **RECALL Subject : FUEL TANK WELD SPOTS/FUEL LEAK/POSSIBLE FIRE**

**Report Receipt Date:** JUN 22, 2012  
**NHTSA Campaign Number:** 12V289000  
**Component(s):** FUEL SYSTEM, GASOLINE

**All Products Associated with this Recall** ▼

**Details** ▲

**12 Associated Documents** ▼

**Manufacturer:** GENERAL MOTORS LLC

**SUMMARY:**

GENERAL MOTORS (GM) IS RECALLING CERTAIN MODEL YEAR 2011 AND 2012 CHEVROLET CRUZE VEHICLES MANUFACTURED FROM OCTOBER 2, 2009, THROUGH MAY 14, 2012. ATTACHMENT WELDS FOR THE FUEL TANK STRAP SECONDARY BRACKETS MAY HAVE BEEN OMITTED.

**CONSEQUENCE:**

THE FUEL TANK COULD COME LOOSE IN A CRASH, POSSIBLY ALLOWING FUEL TO LEAK FROM THE TANK. A FUEL LEAK IN THE PRESENCE OF AN IGNITION SOURCE COULD RESULT IN A FIRE.

**REMEDY:**

GM WILL NOTIFY OWNERS, AND DEALERS WILL INSPECT THE VEHICLE FOR MISSING WELDS. IF THE VEHICLE IS MISSING WELDS, DEALERS WILL SECURE THE BRACKET ATTACHMENTS WITH FASTENERS. REPAIRS WILL BE PERFORMED FREE OF CHARGE. THE SAFETY RECALL

BEGAN ON JULY 9, 2012. OWNERS MAY CONTACT THE CHEVROLET OWNER CENTER AT 1-866-694-6546.

**NOTES:**

GM'S CAMPAIGN NUMBER IS 12133. OWNERS MAY ALSO CONTACT THE NATIONAL HIGHWAY TRAFFIC SAFETY ADMINISTRATION'S VEHICLE SAFETY HOTLINE AT 1-888-327-4236 (TTY 1-800-424-9153), OR GO TO [HTTP://WWW.SAFERCAR.GOV](http://www.safercar.gov) .

---

**– RECALL Subject : OIL SPILLING OR DRIPPING/ENGINE COMPARTMENT FIRE , 1 INVESTIGATION(S)**


---

**Report Receipt Date:** JUN 22, 2012

**NHTSA Campaign Number:** 12V288000

**Component(s):** ENGINE AND ENGINE COOLING

**All Products Associated with this Recall** ▼

**Details** ▲

**12 Associated Documents** ▼

**Manufacturer:** GENERAL MOTORS LLC

**SUMMARY:**

GENERAL MOTORS (GM) IS RECALLING CERTAIN MODEL YEAR 2011 AND 2012 CHEVROLET CRUZE VEHICLES MANUFACTURED FROM OCTOBER 2, 2009, THROUGH MAY 31, 2012. SPILLED OR DRIPPING OIL (SUCH AS AFTER AN OIL CHANGE) MAY COLLECT IN THE ENGINE SHIELD (BELLYPAN) NEAR HOT ENGINE OR EXHAUST SYSTEM SURFACES. AS A RESULT, THE OIL AND THE ENGINE SHIELD MAY IGNITE AND BURN.

**CONSEQUENCE:**

EITHER CONDITION COULD RESULT IN AN ENGINE COMPARTMENT FIRE, POSSIBLY CAUSING INJURY OR DEATH.

**REMEDY:**

GM WILL NOTIFY OWNERS, AND DEALERS WILL MODIFY THE ENGINE SHIELD TO PREVENT FLUID FROM CONTACTING THE SHIELD. ALSO, ON VEHICLES WITH A MANUAL TRANSMISSION, DEALERS WILL APPLY A PROTECTIVE TAPE TO THE ELECTRONIC POWER STEERING WIRE HARNESS. REPAIRS WILL BE PERFORMED FREE OF CHARGE TO THE OWNER. THE SAFETY RECALL BEGAN ON JULY 10, 2012. OWNERS MAY CONTACT THE CHEVROLET OWNER CENTER AT 1-866-694-6546.

**NOTES:**

GM'S CAMPAIGN NUMBER IS 12081. OWNERS MAY ALSO CONTACT THE NATIONAL HIGHWAY TRAFFIC SAFETY ADMINISTRATION'S VEHICLE SAFETY HOTLINE AT 1-888-327-4236 (TTY 1-800-424-9153), OR GO TO [HTTP://WWW.SAFERCAR.GOV](http://www.safercar.gov) .

**1 Associated Investigation(s)** ▼

---

**– RECALL Subject : AUTO TRANS SHIFT LINK INSTALLATION/FMVSS 102 & 114**


---

**Report Receipt Date:** MAY 06, 2011

**NHTSA Campaign Number:** 11V273000

**Component(s):** POWER TRAIN

**All Products Associated with this Recall** ▼

**Details** ▲

**14 Associated Documents** ▼

**Manufacturer:** GENERAL MOTORS LLC

**SUMMARY:**

GENERAL MOTORS IS RECALLING CERTAIN MODEL YEAR 2011 CHEVROLET CRUZE VEHICLES MANUFACTURED FROM OCTOBER 6, 2009, THROUGH APRIL 27, 2011 AND EQUIPPED WITH AN AUTOMATIC TRANSMISSION FOR FAILING TO COMPLY WITH FEDERAL MOTOR VEHICLE SAFETY STANDARD NO. 102, 'TRANSMISSION SHIFT LEVER SEQUENCE, STARTER INTERLOCK, AND TRANSMISSION BRAKING EFFECT,' AND FEDERAL MOTOR VEHICLE SAFETY STANDARD NO. 114, 'THEFT PROTECTION.' THESE VEHICLES MAY HAVE BEEN BUILT WITH A TRANSMISSION SHIFT LINKAGE THAT IS NOT PROPERLY INSTALLED. IF THE LINKAGE IS NOT PROPERLY INSTALLED, THE PRNDL SHIFT LEVER MAY NOT ACCURATELY REFLECT THE POSITION OF THE TRANSMISSION GEAR. WITH THIS CONDITION, THE DRIVER COULD MOVE THE SHIFTER TO PARK AND REMOVE THE IGNITION KEY, BUT THE TRANSMISSION GEAR MAY NOT BE IN PARK.

**CONSEQUENCE:**

THE DRIVER MAY NOT BE ABLE TO RESTART THE VEHICLE AND THE VEHICLE COULD ROLL AWAY AFTER THE DRIVER HAS EXITED THE VEHICLE, RESULTING IN A POSSIBLE CRASH WITHOUT PRIOR WARNING.

**REMEDY:**

DEALERS WILL INSPECT THE TRANSMISSION SHIFT LINKAGE FOR CORRECT INSTALLATION AND ADJUST THE SHIFT LINKAGE SYSTEM FREE OF CHARGE. THE SAFETY RECALL BEGAN ON MAY 23, 2011. OWNERS MAY CONTACT CHEVROLET AT 1-800-630-2438, OR [WWW.GMOWNERCENTER.COM](http://www.gmownercenter.com).

**NOTES:**

GM'S SAFETY RECALL NO. 11142. OWNERS MAY ALSO CONTACT THE NATIONAL HIGHWAY TRAFFIC SAFETY ADMINISTRATION'S VEHICLE SAFETY HOTLINE AT 1-888-327-4236 (TTY 1-800-424-9153), OR GO TO [HTTP://WWW.SAFERCAR.GOV](http://www.safercar.gov) .

## – RECALL Subject : STEERING GEAR SHAFT

Report Receipt Date: MAY 06, 2011  
NHTSA Campaign Number: 11V270000  
Component(s): STEERING

All Products Associated with this Recall ▼

Details ▲

14 Associated Documents ▼

Manufacturer: GENERAL MOTORS LLC

**SUMMARY:**

GENERAL MOTORS IS RECALLING CERTAIN MODEL YEAR 2011 CHEVROLET CRUZE VEHICLES MANUFACTURED FROM OCTOBER 2, 2009, THROUGH APRIL 21, 2011. THE BOLT ATTACHING THE INTERMEDIATE STEERING SHAFT TO THE STEERING GEAR INPUT SHAFT MAY NOT HAVE BEEN PROPERLY INSTALLED.

**CONSEQUENCE:**

THIS COULD ALLOW THE SHAFTS TO SEPARATE, RESULTING IN THE LOSS OF STEERING. LOSS OF STEERING CONTROL MAY INCREASE THE RISK OF A CRASH.

**REMEDY:**

DEALERS WILL INSPECT, AND IF REQUIRED, REPAIR THE INTERMEDIATE SHAFT/STEERING GEAR ASSEMBLY TO ASSURE THE BOLT IS FULLY SEATED AND THE SHAFT PROPERLY ASSEMBLED. THIS SERVICE WILL BE PERFORMED FREE OF CHARGE. THE SAFETY RECALL BEGAN ON MAY 23, 2011. OWNERS MAY CONTACT CHEVROLET AT 1-800-630-2438, OR [WWW.GMOWNERCENTER.COM](http://www.gmownercenter.com).

**NOTES:**

GM'S SAFETY RECALL NO. 11149. OWNERS MAY ALSO CONTACT THE NATIONAL HIGHWAY TRAFFIC SAFETY ADMINISTRATION'S VEHICLE SAFETY HOTLINE AT 1-888-327-4236 (TTY 1-800-424-9153), OR GO TO [HTTP://WWW.SAFERCAR.GOV](http://www.safercar.gov) .

**PLEASE NOTE:**

This web page will be down for maintenance on Friday March 28, 2014 between 7:00 PM and 9:00 PM EDT. We apologize for this brief inconvenience.

## 2012 CHEVROLET CRUZE

Recalls	Investigations	Complaints	Service Bulletins
5	0	147	48

RECALLS: Displaying 1 - 5 out of 5

### – RECALL Subject : Possible Loss of Braking Assist

**Report Receipt Date:** AUG 15, 2013  
**NHTSA Campaign Number:** 13V360000  
**Component(s):** SERVICE BRAKES, HYDRAULIC

All Products Associated with this Recall ▼

Details ▲

6 Associated Documents ▼

**Manufacturer:** General Motors LLC

#### SUMMARY:

General Motors (GM) is recalling certain model year 2011-2012 Chevrolet Cruze vehicles equipped with 1.4L DOHC gasoline turbo engines and 6T40 front wheel drive automatic transmissions and equipped with an electric vacuum pump to provide supplemental vacuum for brake assist, when needed. In the affected vehicles, the pump may not activate, resulting in an intermittent reduction or loss of brake assist.

#### CONSEQUENCE:

A loss of braking assistance will require extra pedal force and/or distance to bring the vehicle to a stop, increasing the risk of a crash.

#### REMEDY:

General Motors will notify owners, and dealers will replace a microswitch in the power brake vacuum pipe assembly, free of charge. The recall began on October 7, 2013. Owners may contact Chevrolet at 1-800-222-1020. GM's recall number is 12213.

#### NOTES:

Owners may also contact the National Highway Traffic Safety Administration Vehicle Safety Hotline at 1-888-327-4236 (TTY 1-800-424-9153), or go to [www.safercar.gov](http://www.safercar.gov).

### – RECALL Subject : Driver Side Frontal Airbag may not Deploy , 1 INVESTIGATION(S)

**Report Receipt Date:** JAN 24, 2013  
**NHTSA Campaign Number:** 13V023000  
**Component(s):** AIR BAGS

All Products Associated with this Recall ▼

Details ▲

10 Associated Documents ▼

**Manufacturer:** General Motors LLC

#### SUMMARY:

General Motors is recalling certain model year 2012 Chevrolet Camaro, Buick Verano, Chevrolet Cruze, and Chevrolet Sonic vehicles. The driver side frontal air bag has a shorting bar which may intermittently contact the air bag terminals.

#### CONSEQUENCE:

If the bar and terminals are contacting each other at the time of a crash necessitating deployment of the driver's frontal airbag, that airbag will not deploy, increasing the driver's risk of injury.

#### REMEDY:

General Motors will notify owners, and dealers will replace the steering wheel airbag coil, free of charge. The safety recall began on February 13, 2013. Owners may contact General Motors at 1-800-521-7300.

**NOTES:**

This is General Motors recall number 12261 and is an expansion of NHTSA recall 12V-522. Owners may also contact the National Highway Traffic Safety Administration Vehicle Safety Hotline at 1-888-327-4236 (TTY 1-800-424-9153), or go to [www.safercar.gov](http://www.safercar.gov).

**1 Associated Investigation(s)** ▼**– RECALL Subject : Driver Side Frontal Airbag may not Deploy**

**Report Receipt Date:** OCT 31, 2012

**NHTSA Campaign Number:** 12V522000

**Component(s):** AIR BAGS

**All Products Associated with this Recall** ▼**Details** ▲**8 Associated Documents** ▼

**Manufacturer:** General Motors LLC

**SUMMARY:**

General Motors is recalling certain model year 2012 Buick Verano, Chevrolet Cruze, and Chevrolet Sonic vehicles. The driver side frontal air bag has a shorting bar which may intermittently contact the air bag terminals.

**CONSEQUENCE:**

If the bar and terminals are contacting each other at the time of a crash necessitating deployment of the driver's frontal airbag, that airbag will not deploy, increasing the driver's risk of injury.

**REMEDY:**

General Motors will notify owners, and dealers will replace the steering wheel airbag coil, free of charge. The safety recall began on January 11, 2013. Owners may contact General Motors at 1-800-521-7300.

**NOTES:**

This is General Motors recall number 12261. Owners may also contact the National Highway Traffic Safety Administration Vehicle Safety Hotline at 1-888-327-4236 (TTY 1-800-424-9153), or go to [www.safercar.gov](http://www.safercar.gov).

**– RECALL Subject : FUEL TANK WELD SPOTS/FUEL LEAK/POSSIBLE FIRE**

**Report Receipt Date:** JUN 22, 2012

**NHTSA Campaign Number:** 12V289000

**Component(s):** FUEL SYSTEM, GASOLINE

**All Products Associated with this Recall** ▼**Details** ▲**12 Associated Documents** ▼

**Manufacturer:** GENERAL MOTORS LLC

**SUMMARY:**

GENERAL MOTORS (GM) IS RECALLING CERTAIN MODEL YEAR 2011 AND 2012 CHEVROLET CRUZE VEHICLES MANUFACTURED FROM OCTOBER 2, 2009, THROUGH MAY 14, 2012. ATTACHMENT WELDS FOR THE FUEL TANK STRAP SECONDARY BRACKETS MAY HAVE BEEN OMITTED.

**CONSEQUENCE:**

THE FUEL TANK COULD COME LOOSE IN A CRASH, POSSIBLY ALLOWING FUEL TO LEAK FROM THE TANK. A FUEL LEAK IN THE PRESENCE OF AN IGNITION SOURCE COULD RESULT IN A FIRE.

**REMEDY:**

GM WILL NOTIFY OWNERS, AND DEALERS WILL INSPECT THE VEHICLE FOR MISSING WELDS. IF THE VEHICLE IS MISSING WELDS, DEALERS WILL SECURE THE BRACKET ATTACHMENTS WITH FASTENERS. REPAIRS WILL BE PERFORMED FREE OF CHARGE. THE SAFETY RECALL BEGAN ON JULY 9, 2012. OWNERS MAY CONTACT THE CHEVROLET OWNER CENTER AT 1-866-694-6546.

**NOTES:**

GM'S CAMPAIGN NUMBER IS 12133. OWNERS MAY ALSO CONTACT THE NATIONAL HIGHWAY TRAFFIC SAFETY ADMINISTRATION'S VEHICLE SAFETY HOTLINE AT 1-888-327-4236 (TTY 1-800-424-9153), OR GO TO [HTTP://WWW.SAFERCAR.GOV](http://www.safercar.gov) .

**– RECALL Subject : OIL SPILLING OR DRIPPING/ENGINE COMPARTMENT FIRE , 1 INVESTIGATION(S)**

**Report Receipt Date:** JUN 22, 2012

**NHTSA Campaign Number:** 12V288000

**Component(s):** ENGINE AND ENGINE COOLING

**All Products Associated with this Recall** ▼**Details** ▲**12 Associated Documents** ▼



**Manufacturer:** GENERAL MOTORS LLC

**SUMMARY:**

GENERAL MOTORS (GM) IS RECALLING CERTAIN MODEL YEAR 2011 AND 2012 CHEVROLET CRUZE VEHICLES MANUFACTURED FROM OCTOBER 2, 2009, THROUGH MAY 31, 2012. SPILLED OR DRIPPING OIL (SUCH AS AFTER AN OIL CHANGE) MAY COLLECT IN THE ENGINE SHIELD (BELLYPAN) NEAR HOT ENGINE OR EXHAUST SYSTEM SURFACES. AS A RESULT, THE OIL AND THE ENGINE SHIELD MAY IGNITE AND BURN.

**CONSEQUENCE:**

EITHER CONDITION COULD RESULT IN AN ENGINE COMPARTMENT FIRE, POSSIBLY CAUSING INJURY OR DEATH.

**REMEDY:**

GM WILL NOTIFY OWNERS, AND DEALERS WILL MODIFY THE ENGINE SHIELD TO PREVENT FLUID FROM CONTACTING THE SHIELD. ALSO, ON VEHICLES WITH A MANUAL TRANSMISSION, DEALERS WILL APPLY A PROTECTIVE TAPE TO THE ELECTRONIC POWER STEERING WIRE HARNESS. REPAIRS WILL BE PERFORMED FREE OF CHARGE TO THE OWNER. THE SAFETY RECALL BEGAN ON JULY 10, 2012. OWNERS MAY CONTACT THE CHEVROLET OWNER CENTER AT 1-866-694-6546.

**NOTES:**

GM'S CAMPAIGN NUMBER IS 12081. OWNERS MAY ALSO CONTACT THE NATIONAL HIGHWAY TRAFFIC SAFETY ADMINISTRATION'S VEHICLE SAFETY HOTLINE AT 1-888-327-4236 (TTY 1-800-424-9153), OR GO TO [HTTP://WWW.SAFERCAR.GOV](http://www.safercar.gov) .

1 Associated Investigation(s) ▼



**PLEASE NOTE:**  
 This web page will be down for maintenance on Friday March 28, 2014 between 7:00 PM and 9:00 PM EDT. We apologize for this brief inconvenience.

## 2013 CHEVROLET CRUZE

Recalls	Investigations	Complaints	Service Bulletins
<b>1</b>	<b>0</b>	<b>46</b>	<b>18</b>

RECALLS: Displaying 1 - 1 out of 1

– [RECALL Subject : Front Right Half Shaft may Fracture](#)

**Report Receipt Date:** SEP 23, 2013  
**NHTSA Campaign Number:** 13V452000  
**Component(s):** POWER TRAIN

**All Products Associated with this Recall** ▼

**Details** ▲

[5 Associated Documents](#) ▼

**Manufacturer:** General Motors LLC

**SUMMARY:**

General Motors (GM) is recalling certain model year 2013 and 2014 Chevrolet Cruze vehicles equipped with manual transmissions (MF3/MR5) and manufactured January 24, 2013, through August 1, 2013. On the affected vehicles, the right front half shaft may fracture and separate.

**CONSEQUENCE:**

If the half shaft fractures and separates while driving, the vehicle would lose power and coast to a stop. If a vehicle with a fractured half shaft is parked without the parking brake applied, the vehicle could move unexpectedly. Either condition increases the risk of a crash.

**REMEDY:**

General Motors has notified owners. Dealers will replace the half shaft assembly, free of charge. The safety recall began on October 15, 2013. Owners may contact General Motors at 1-800-521-7300. This is General Motors campaign number 13276.

**NOTES:**

Owners may also contact the National Highway Traffic Safety Administration Vehicle Safety Hotline at 1-888-327-4236 (TTY 1-800-424-9153), or go to [www.safercar.gov](http://www.safercar.gov).



**PLEASE NOTE:**  
 This web page will be down for maintenance on Friday March 28, 2014 between 7:00 PM and 9:00 PM EDT. We apologize for this brief inconvenience.

## 2014 CHEVROLET CRUZE

Recalls	Investigations	Complaints	Service Bulletins
2	0	9	6

RECALLS: Displaying 1 - 2 out of 2

– RECALL Subject : Broken Transmission Adjuster Cable/FMVSS 102/114

Report Receipt Date: FEB 21, 2014  
 NHTSA Campaign Number: 14V092000  
 Component(s):

All Products Associated with this Recall ▼

Details ▲

2 Associated Documents ▼

Manufacturer: General Motors LLC

**SUMMARY:**

General Motors LLC (GM) is recalling certain model year 2014 Buick Regal, LaCrosse, Verano, and Enclave, and Chevrolet Impala, Malibu, Cruze, and Traverse, and GMC Acadia vehicles equipped with automatic transmissions. In the affected vehicles, the transmission shift cable adjuster may disengage from the transmission shift lever. As such, these vehicles do not conform to Federal Motor Vehicle Safety Standard (FMVSS) number 102, "Transmission Shift Lever Sequence, Starter Interlock, and Transmission Braking Effect." They also fail to conform to FMVSS number 114, "Theft Protection and Rollaway Prevention."

**CONSEQUENCE:**

If a vehicle's shift cable disengages from the transmission shift lever, a driver may be unable to shift gear positions and the indicated shift position may not represent the gear position the vehicle is in. Should a disengagement occur while the vehicle is being driven, when the driver goes to stop and park the vehicle, the driver may be able to shift the lever to the "PARK" position, but the vehicle transmission may not be in the "PARK" gear position. If the vehicle is not in the "PARK" position there is a risk the vehicle will roll away as the driver and other occupants exit the vehicle or anytime thereafter. A vehicle rollaway increases the risk of injury to exiting occupants and bystanders.

**REMEDY:**

General Motors will notify owners, and dealers will inspect and replace any affected transmission shift cable adjusters, free of charge. The recall is expected to begin in late March 2014. Chevrolet owners may contact General Motors at 1-800-222-1020, Buick owners at 1-800-521-7300, and GMC owners at 1-800-462-8782. General Motors' number associated with this recall is 14048.

**NOTES:**

Owners may also contact the National Highway Traffic Safety Administration Vehicle Safety Hotline at 1-888-327-4236 (TTY 1-800-424-9153), or go to [www.safercar.gov](http://www.safercar.gov).

– RECALL Subject : Front Right Half Shaft may Fracture

Report Receipt Date: SEP 23, 2013  
 NHTSA Campaign Number: 13V452000  
 Component(s): POWER TRAIN

All Products Associated with this Recall ▼

Details ▲

5 Associated Documents ▼

Manufacturer: General Motors LLC

**SUMMARY:**

General Motors (GM) is recalling certain model year 2013 and 2014 Chevrolet Cruze vehicles equipped with manual transmissions (MF3/MR5) and manufactured January 24, 2013, through August 1, 2013. On the affected vehicles, the right front half shaft may fracture and separate.

**CONSEQUENCE:**

If the half shaft fractures and separates while driving, the vehicle would lose power and coast to a stop. If a vehicle with a fractured half shaft is parked without the parking brake applied, the vehicle could move unexpectedly. Either condition increases the risk of a crash.

**REMEDY:**

General Motors has notified owners. Dealers will replace the half shaft assembly, free of charge. The safety recall began on October 15, 2013. Owners may contact General Motors at 1-800-521-7300. This is General Motors campaign number 13276.

**NOTES:**

Owners may also contact the National Highway Traffic Safety Administration Vehicle Safety Hotline at 1-888-327-4236 (TTY 1-800-424-9153), or go to [www.safercar.gov](http://www.safercar.gov).

---

1200 New Jersey Avenue, SE, West Building Washington DC 20590 USA 1.888.327.4236 TTY 1.800.424.9153



U.S. Department of Transportation  
**National Highway Traffic Safety  
Administration**

1200 New Jersey Avenue SE  
Washington, DC 20590

March 20, 2014

Ms. Carmen Benavides  
Director, Product Investigations  
General Motors LLC  
30001 Van Dyke - Mail Code 480-210-2V  
Warren, MI 48090-9055

NVS-215KS  
14V-092

**Subject:** Broken Transmission Adjuster Cable/FMVSS 102/114

Dear Ms. Benavides:

This letter serves to acknowledge General Motors LLC's notification to the National Highway Traffic Safety Administration (NHTSA) of a safety recall which will be conducted pursuant to Federal law for the product(s) listed below. Please review the following information to ensure that it conforms to your records as this information is being made available to the public. If the information does not agree with your records, please contact us immediately to discuss your concerns.

**Makes/Models/Model Years:**

BUICK/ENCLAVE/2014  
BUICK/LACROSSE/2014  
BUICK/REGAL/2014  
BUICK/VERANO/2014  
CHEVROLET/CRUZE/2014  
CHEVROLET/IMPALA/2014  
CHEVROLET/MALIBU/2014  
CHEVROLET/TRVERSE/2014  
GMC/ACADIA/2014

**Mfr's Report Date:** February 20, 2014

**NHTSA Campaign Number:** 14V-092

**Components:**

POWER TRAIN:AUTOMATIC TRANSMISSION

**Potential Number of Units Affected:** 355

**Problem Description:**

General Motors LLC (GM) is recalling certain model year 2014 Buick Regal, LaCrosse, Verano, and Enclave, and Chevrolet Impala, Malibu, Cruze, and Traverse, and GMC Acadia vehicles equipped with automatic transmissions. In the affected vehicles, the transmission shift cable adjuster may disengage from the transmission shift lever. As such, these vehicles do not conform to Federal Motor Vehicle Safety Standard (FMVSS) number 102, "Transmission Shift Lever Sequence, Starter Interlock, and Transmission Braking Effect." They also fail to conform to FMVSS number 114, "Theft Protection and Rollaway Prevention."

**Consequence:**

If a vehicle's shift cable disengages from the transmission shift lever, a driver may be unable to shift gear positions and the indicated shift position may not represent the gear position the vehicle is in. Should a disengagement occur while the vehicle is being driven, when the driver goes to stop and park the vehicle, the driver may be able to shift the lever to the "PARK" position, but the vehicle transmission may not be in the "PARK" gear position. If the vehicle is not in the "PARK" position there is a risk the vehicle will roll



away as the driver and other occupants exit the vehicle or anytime thereafter. A vehicle rollaway increases the risk of injury to exiting occupants and bystanders.

**Remedy:**

General Motors will notify owners, and dealers will inspect and replace any affected transmission shift cable adjusters, free of charge. The recall is expected to begin in late March 2014. Chevrolet owners may contact General Motors at 1-800-222-1020, Buick owners at 1-800-521-7300, and GMC owners at 1-800-462-8782. General Motors' number associated with this recall is 14048.

**Notes:**

Owners may also contact the National Highway Traffic Safety Administration Vehicle Safety Hotline at 1-888-327-4236 (TTY 1-800-424-9153), or go to [www.safercar.gov](http://www.safercar.gov).

Under 49 U.S.C. § 30112(a), it is illegal for anyone, including a manufacturer, distributor, dealer, or retailer to sell an item of equipment or vehicle that fails to comply with all applicable Federal motor vehicle safety standards.

We have received GM's proposed owner notification letter and it is currently under review. You will be notified of any changes or concerns once our review is complete.

Please be reminded of the following requirements:

Copies of all notices, bulletins, dealer notifications, and other communications that relate to this recall, including a copy of the final owner notification letter and any subsequent owner follow-up notification letter(s), are required to be submitted to this office no later than 5 days after they are originally sent (if they are sent to more than one manufacturer, distributor, dealer, or purchaser/owner).

As stated in Part 573.7, submission of the first of six consecutive quarterly status reports is required within one month after the close of the calendar quarter in which notification to purchasers occurs. Therefore, the first quarterly report will be due on, or before, 30 days after the close of the calendar quarter.

Your contact for this recall will be Kelly Schuler who may be reached by phone at (202) 366-5227, or by email at [kelly.schuler@dot.gov](mailto:kelly.schuler@dot.gov) or through the office email at [rmd.odi@dot.gov](mailto:rmd.odi@dot.gov). We look forward to working with you.

Sincerely,



Jennifer Timian  
Chief, Recall Management Division  
Office of Defects Investigations  
Enforcement